

Australia Product Safety Recall

(For Australian Customers Only)

Product Description:

Certain Traxxas radio controlled model vehicles, replacement slipper or brake pad parts, or replacement part assemblies containing slipper or brake pads (e.g., complete transmission kits, slipper assemblies).

Why is the product being recalled?


The slipper pads in certain electric models and the brake pads in certain nitro fuel models may contain trace amounts of chrysotile asbestos. The importation of asbestos or goods containing asbestos into Australia is prohibited under the Customs (Prohibited Imports) Regulations 1956 (Customs Prohibited Import Regulations).

Slipper pads are composite material pads that measure 14x6x2.5mm and weigh approximately 1 gram per set of 3. Nitro model brake pads are similar. The friction pads are non-friable (i.e., do not easily crumble, break apart, or release dust or fibers), generate minimal dust from wear, and for all electric models are enclosed within a cover on the transmission assembly. See below for examples.



Traxxas slipper pads with size reference

Qty 3 (one set)

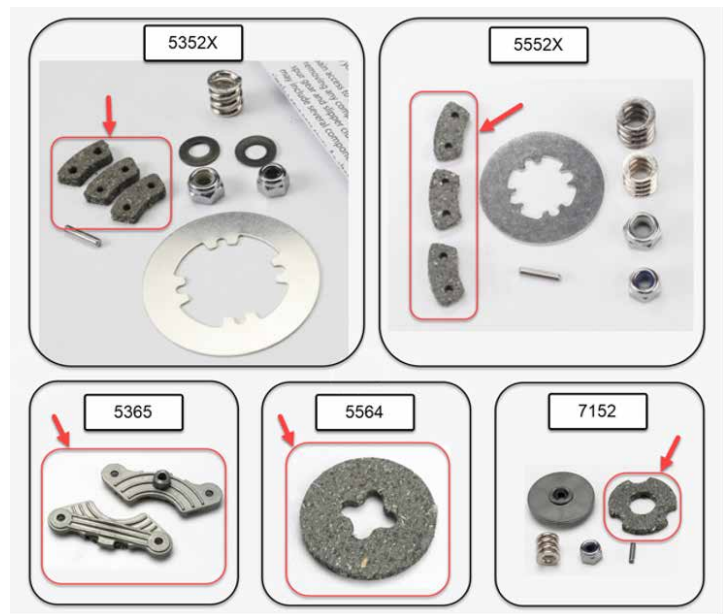

What should consumers do?

Consumers should stop using affected vehicles and not attempt to remove or replace the slipper or brake pads or disassemble the slipper assembly.

Affected vehicles should be returned to their place of purchase to be sent to a centralized repair facility for a free repair, which consists of having the affected components replaced.

If your vehicle was bought second-hand, your place of purchase is no longer in business, or you do not remember where you purchased the vehicle, you should contact Southern Model Supplies for further instructions.

For additional information, contact Southern Model Supplies by telephone at 1800 888 472 or by email at sales@southernmodels.com.au.



What are the hazards?

The presence of trace amounts of asbestos. Asbestos is known to present a risk of serious medical conditions, including asbestosis, lung cancer, and mesothelioma if asbestos fibers are released into the air and breathed in.

Supplier: Traxxas, L.P.

Traders who sold the product:

Authorised Traxxas dealers (see dealer look-up tool at <https://www.traxxas.com/findadealer>)

Where the product was sold: Nationally Online

Dates available for sale: 1 Jan 2002 - 27 Feb 2023

Affected Models and Parts

Traxxas 2wd Electric models with 5552X friction pads:

- Bandit, 240XX
- Stampede, 360XX
- Rustler, 370XX
- Slash, 580XX
- Drag Slash, 94076-4



Bandit, 240XX



Stampede, 360XX



Rustler, 370XX



Slash, 580XX



Drag Slash, 94076-4

Traxxas 4wd Electric models with 5552X friction pads:

- Stampede 4X4, 670XX (excludes Ruster 4X4, 67064 and 67076)
- Slash 4X4, 680XX
- Rally VXL, 7407X
- E-Revo and Summit, 560XX and 5610 (excludes E-Revo, 86086)
- E-Maxx, 390XX



Stampede 4X4, 670XX



Slash 4X4, 680XX



Rally VXL, 7407X



E-Revo 560XX



Summit, 5610



E-Maxx, 390XX

Traxxas Electric models with 7152 slipper clutch pad:

- 1/16 Slash 4X4, 700XX
- 1/16 E-Revo, 710XX
- 1/16 Summit, 720XX
- 1/16 Rally, Mustang, Nastruck, Fiesta 73XX
- Ford Fiesta ST Rally, 74054 and 74064
- Telluride, 67044



1/16 Slash 4X4, 700XX



1/16 E-Revo, 710XX



1/16 Summit, 720XX



1/16 Rally, 73XX



1/16 Mustang, 73XX



1/16 Nastruck, 73XX



1/16 Fiesta, 73XX



Ford Fiesta ST Rally, 74054
and 74064



Telluride, 67044

Traxxas Nitro models with 5352X friction pads, 5365 brake pads, and/or 5564 brake disc:

- Jato, 550XX and 5510
- Slayer, 590XX
- T-Maxx, 490XX
- Revo, 530XX and 5310



Jato, 550XX and 5510



Slayer, 590XX



T-Maxx, 490XX



Revo, 590XX and 5310



Parts affected:

5352X	Rebuild kit, slipper clutch (steel disc/ friction pads (3)/ spring (1)/ 2x9.8mm pin/ 5x8mm MW/ 5.0mm NL (1)/ 4.0mm NL (1))
5552X	Rebuild kit, slipper clutch (steel disc/ friction pads (3)/ spring (2)/ pin/ 4.0mm NL (1)/ 5.0mm NL (1))
6878	Slipper clutch, complete (for Slash 4x4)
3695	Transmission, complete (fits 1/10-scale 2WD Rustler®, Bandit®, Stampede®, Slash®)
4983	Transmission, complete (fits T-Maxx® 3.3)
5491	Transmission, complete (fits Revo® 3.3)
5691	Transmission, complete (fits Summit (2-speed))
9495	Pro Series Magnum 272R, Transmission, complete (assembled) (fits 1/10-scale 2WD Rustler®, Bandit®, Stampede®, Slash®)
5351X	T-Maxx® Torque Control Slipper Upgrade Kit (fits first generation T-Maxx® transmission, w/o Optidrive®) (patent pending)
5352	Rebuild kit, slipper clutch (steel disc/ friction pads (3)/ spring/ 2x9.8mm pin/ 5x8mm MW/ 5.0mm NL)
5552	Rebuild kit, slipper clutch (steel disc/ friction pads (3)/ spring/ pin/ 4.0mm NL)
7152	Slipper clutch, complete (includes slipper clutch hub, clutch pad, spring, 3.0mm NL, 1.5x6mm pin)
6766	Gear clutch, complete (high stall)
7095	Transmission, complete (fits 1/16-scale brushed models)
7096	Transmission, complete (fits 1/16-scale VXL models)
5365	Brake pad set (inner and outer calipers with bonded friction material)
4983	Transmission, complete (fits T-Maxx® 3.3)
5491	Transmission, complete (fits Revo® 3.3)
5564	Brake disc (semi-metallic material)
5417	Brake kit (dual disc rear for Revo®) (Requires center differential kit, part 5414)

